

Work Order ID 92777

November-07-12 3:32:15 PM

92777

Page 1

Item ID: D2580-1

Accept

N9000040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: 205 Skidtube bent detail

Start Date: 07/11/2012 Start Qty: 5.00

5

Cust Item ID:

Required Date: 21/11/2012 Req'd Qty: 5.00

5

Customer:

Reference:

Approvals: Process Plan: MCS

Date: 12-11-07 Tooling:

Run Start ***NR1***

QC:

Date: SPC (Y/N):

Date:

Stop ***NR2***

Date:

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

| Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|---------|--------|-----------|------------|------------|---------------|-------------|
|---------|--------|-----------|------------|------------|---------------|-------------|

Draw Nbr

Revision Nbr

D2580

E

100

0.00

100

Skidtubes

Skidtubes

Memo

0.00

1- Inspect mat'l D2500-1-190 for damage.

2-Drill pilot holes using drill jig DT 8149 (Do not use cutting fluid)

3-Open holes to 0.500" as per Dwg D2580 without cutting fluid

4-Deburr holes per QSI002 section 4.2.3 and blow out all chips from inside of tube

OK 12/11/08

DP 12-11-8

101

QC6- Inspect dimensions to drawing

0.00

101

QC

Quality Control

Memo

0.00

5 12-11-08 DAS 18

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | |
|--|------|------|-----|---|-------------------|---|-------------|--------------|--------------|--|--|
| Work Order: _____ Part No. _____ NCR No. _____ | | | | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | | AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div> | | | | | |
| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector | | |
| Doc/Data | | | | | | | | | | | |
| Equip/Tooling | | | | | | | | | | | |
| Operator | | | | | | | | | | | |
| Material | | | | | | | | | | | |
| Setup | | | | | | | | | | | |
| Other | | | | | | | | | | | |
| Process | | | | | | | | | | | |
| Supplier | | | | | | | | | | | |
| Training | | | | | | | | | | | |
| Unapproved | | | | | | | | | | | |

| FAULT CATEGORY | | | |
|--|---|---|---|
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio | <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions | <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other |

Work Order ID 92777

92777

Page 2

Item ID: D2580-1

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: 205 Skidtube bent detail

Start Date: 07/11/2012 Start Qty: 5.00 ***5***

Cust Item ID:

Required Date: 21/11/2012 Req'd Qty: 5.00 ***5***

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date: Run Start ***NR1***
QC: Date: SPC (Y/N): Date: Stop ***NR2***

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|

110 Chemical Conversion Coat per QSI005 4.1 0.00

110

HandFinish

Memo

0.00

Hand Finishing

5 7/6/12-9

120 QC7-Inspect Chemical Conversion Coat 0.00

120

QC

Memo

0.00

Quality Control

D4
89

5 12-11-13

125 0.00

125

Skidtubes

Memo

0.00

Skidtubes

5 CF 12-11-13

A/R Sikaflex-291 batch: M123353

Sikaflex expire date: 13-06-22

Start time and date: 14:15 bond for 12hrs

12-11-13

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="width: 25%;">Skid-tube <input type="checkbox"/></td> <td style="width: 25%;">Crosstube <input type="checkbox"/></td> <td style="width: 25%;">Water Jet <input type="checkbox"/></td> <td style="width: 25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Operator | | | | | | | | | |
| Material | | | | | | | | | |
| Setup | | | | | | | | | |
| Other | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| Landing Gear | General | Other |
|---|---|--|
| <input type="checkbox"/> Bending | <input type="checkbox"/> Bend | <input type="checkbox"/> Grain |
| <input type="checkbox"/> Centre Not Concentric to O/S | <input type="checkbox"/> BOM/Route | <input type="checkbox"/> Hardware |
| <input type="checkbox"/> Cracks | <input type="checkbox"/> Broken/Damaged | <input type="checkbox"/> Inspection Incomplete |
| <input type="checkbox"/> Crushed/Crimped | <input type="checkbox"/> Burrs | <input type="checkbox"/> Instructions Incomplete/Unclear |
| <input type="checkbox"/> Cuffs | <input type="checkbox"/> Contamination | <input type="checkbox"/> Maintenance |
| <input type="checkbox"/> Heat Treat | <input type="checkbox"/> Countersink | <input type="checkbox"/> Mislabeled |
| <input type="checkbox"/> Inspection Strip in Tube | <input type="checkbox"/> Cut Too Short | <input type="checkbox"/> Misread |
| <input type="checkbox"/> Ripples in Bend | <input type="checkbox"/> Drill Holes | <input type="checkbox"/> Offset |
| <input type="checkbox"/> Torque Waves in Extrusion | <input type="checkbox"/> Drawing | <input type="checkbox"/> Out of Calibration |
| <input type="checkbox"/> Turning Sequence | <input type="checkbox"/> Finish | <input type="checkbox"/> Out of Sequence |
| <input type="checkbox"/> Wave/Twist in Tube | <input type="checkbox"/> Folio | <input type="checkbox"/> Outside Dimensions |
| | | <input type="checkbox"/> Ovalized |
| | | <input type="checkbox"/> Over/Under tolerance |
| | | <input type="checkbox"/> Part Incorrect |
| | | <input type="checkbox"/> Part Lost/Missing |
| | | <input type="checkbox"/> Part Moved |
| | | <input type="checkbox"/> Positioned Wrong |
| | | <input type="checkbox"/> Power Loss/Surge |
| | | <input type="checkbox"/> Pressure/Forced |
| | | <input type="checkbox"/> Temperature/Cure |
| | | <input type="checkbox"/> Weld |
| | | <input type="checkbox"/> Wrong Stock Pulled |
| | | <input type="checkbox"/> Other |

Work Order ID 92777

November-07-12 3:32:15 PM

92777

Page 3

Item ID: D2580-1

Accept

N9000040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: 205 Skidtube bent detail

Start Date: 07/11/2012 Start Qty: 5.00

5

Cust Item ID:

Required Date: 21/11/2012 Req'd Qty: 5.00

5

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

130

QC5- Inspect part completeness to step on W/O

0.00

130

QC

Memo

0.00

Quality Control



DP 12-11-14

140

Identify as per dwg & Stock Location: 46

0.00

140

Packaging

Memo

0.00

Packaging

⑤ DP 12-11-14

150

QC21- Final Inspection - Work Order Release

0.00

150

QC

Memo

0.00

Quality Control

12/11/15

12.11.14

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Operator | | | | | | | | | |
| Material | | | | | | | | | |
| Setup | | | | | | | | | |
| Other | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| Landing Gear | General | Other |
|---|---|--|
| <input type="checkbox"/> Bending | <input type="checkbox"/> Bend | <input type="checkbox"/> Grain |
| <input type="checkbox"/> Centre Not Concentric to O/S | <input type="checkbox"/> BOM/Route | <input type="checkbox"/> Hardware |
| <input type="checkbox"/> Cracks | <input type="checkbox"/> Broken/Damaged | <input type="checkbox"/> Inspection Incomplete |
| <input type="checkbox"/> Crushed/Crimped | <input type="checkbox"/> Burrs | <input type="checkbox"/> Instructions Incomplete/Unclear |
| <input type="checkbox"/> Cuffs | <input type="checkbox"/> Contamination | <input type="checkbox"/> Maintenance |
| <input type="checkbox"/> Heat Treat | <input type="checkbox"/> Countersink | <input type="checkbox"/> Mislabeled |
| <input type="checkbox"/> Inspection Strip in Tube | <input type="checkbox"/> Cut Too Short | <input type="checkbox"/> Misread |
| <input type="checkbox"/> Ripples in Bend | <input type="checkbox"/> Drill Holes | <input type="checkbox"/> Offset |
| <input type="checkbox"/> Torque Waves in Extrusion | <input type="checkbox"/> Drawing | <input type="checkbox"/> Out of Calibration |
| <input type="checkbox"/> Turning Sequence | <input type="checkbox"/> Finish | <input type="checkbox"/> Out of Sequence |
| <input type="checkbox"/> Wave/Twist in Tube | <input type="checkbox"/> Folio | <input type="checkbox"/> Outside Dimensions |
| | | <input type="checkbox"/> Ovalized |
| | | <input type="checkbox"/> Over/Under tolerance |
| | | <input type="checkbox"/> Part Incorrect |
| | | <input type="checkbox"/> Part Lost/Missing |
| | | <input type="checkbox"/> Part Moved |
| | | <input type="checkbox"/> Positioned Wrong |
| | | <input type="checkbox"/> Power Loss/Surge |
| | | <input type="checkbox"/> Pressure/Forced |
| | | <input type="checkbox"/> Temperature/Cure |
| | | <input type="checkbox"/> Weld |
| | | <input type="checkbox"/> Wrong Stock Pulled |
| | | <input type="checkbox"/> Other |

Picklist Print

November-07-12 3:32:19 PM

Page 1

Work Order ID: 92777

92777

Parent Item: D2580-1

D2580-1

Parent Item Name: 205 Skidtube bent detail

Start Date: 07/11/2012

Required Date: 21/11/2012

Start Qty: 5.00

Required Qty: 5.00

Comments: IPP B01.11.08 Revised Step 9, 10, 12, and 13 SM IPP Rev:C
10.12.01 as per DEO D1 DD ver:ec

| Component Item ID/ Item Name | Replacement Item ID | Mfg/ Purch | Bin Item | Primary Location | Last Location | Route Seq ID | Unit of Measure | Qty on Hand | Qty per Kit | Total Qty | Qty Issued | Date Issued | Status |
|---------------------------------|------------------------|---------------|-------------|---------------------|------------------|-----------------|--------------------|----------------|-------------|--------------|---------------|----------------|--------|
|---------------------------------|------------------------|---------------|-------------|---------------------|------------------|-----------------|--------------------|----------------|-------------|--------------|---------------|----------------|--------|

D2500-1-190

Manufactured No

100

Each

63.0000

1

5

D2500-1-190

Ext'n -1' Beam Tube 4"

**

DC 12/11/08

Location

Loc Qty

Loc Code

HALL

63

74777

4

85483

59

D2596

Manufactured No

100

Each

1.0000

1

5

D2596

Web, 205 Skidtube

**

CF 12/11/13

Location

Loc Qty

Loc Code

LG

1

80820

1

92778

5

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Skid-tube <input type="checkbox"/></td> <td style="width: 33%;">Crosstube <input type="checkbox"/></td> <td style="width: 33%;">Water Jet <input type="checkbox"/></td> <td style="width: 33%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|--|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data <input type="checkbox"/> | | | | | | | | | |
| Equip/Tooling <input type="checkbox"/> | | | | | | | | | |
| Operator <input type="checkbox"/> | | | | | | | | | |
| Material <input type="checkbox"/> | | | | | | | | | |
| Setup <input type="checkbox"/> | | | | | | | | | |
| Other <input type="checkbox"/> | | | | | | | | | |
| Process <input type="checkbox"/> | | | | | | | | | |
| Supplier <input type="checkbox"/> | | | | | | | | | |
| Training <input type="checkbox"/> | | | | | | | | | |
| Unapproved <input type="checkbox"/> | | | | | | | | | |

FAULT CATEGORY

| Landing Gear | General | Other | Other |
|---|---|--|---|
| <input type="checkbox"/> Bending | <input type="checkbox"/> Bend | <input type="checkbox"/> Grain | <input type="checkbox"/> Ovalized |
| <input type="checkbox"/> Centre Not Concentric to O/S | <input type="checkbox"/> BOM/Route | <input type="checkbox"/> Hardware | <input type="checkbox"/> Over/Under tolerance |
| <input type="checkbox"/> Cracks | <input type="checkbox"/> Broken/Damaged | <input type="checkbox"/> Inspection Incomplete | <input type="checkbox"/> Part Incorrect |
| <input type="checkbox"/> Crushed/Crimped | <input type="checkbox"/> Burrs | <input type="checkbox"/> Instructions Incomplete/Unclear | <input type="checkbox"/> Part Lost/Missing |
| <input type="checkbox"/> Cuffs | <input type="checkbox"/> Contamination | <input type="checkbox"/> Maintenance | <input type="checkbox"/> Part Moved |
| <input type="checkbox"/> Heat Treat | <input type="checkbox"/> Countersink | <input type="checkbox"/> Mislabeled | <input type="checkbox"/> Positioned Wrong |
| <input type="checkbox"/> Inspection Strip in Tube | <input type="checkbox"/> Cut Too Short | <input type="checkbox"/> Misread | <input type="checkbox"/> Power Loss/Surge |
| <input type="checkbox"/> Ripples in Bend | <input type="checkbox"/> Drill Holes | <input type="checkbox"/> Offset | <input type="checkbox"/> Pressure/Forced |
| <input type="checkbox"/> Torque Waves in Extrusion | <input type="checkbox"/> Drawing | <input type="checkbox"/> Out of Calibration | <input type="checkbox"/> Temperature/Cure |
| <input type="checkbox"/> Turning Sequence | <input type="checkbox"/> Finish | <input type="checkbox"/> Out of Sequence | <input type="checkbox"/> Weld |
| <input type="checkbox"/> Wave/Twist in Tube | <input type="checkbox"/> Folio | <input type="checkbox"/> Outside Dimensions | <input type="checkbox"/> Wrong Stock Pulled |
| | | | <input type="checkbox"/> Other |

| LIST OF MATERIALS | | | | | |
|-------------------|-------------|-------------|-------------|---|---------------------|
| ITEM | QTY -041 | QTY -045 | QTY -047 | PART NUMBER | DESCRIPTION |
| 1 | X | | | D2580-041 | SKIDTUBE ASSEMBLY |
| 2 | | X | | D2580-045 | SKIDTUBE ASSEMBLY |
| 3 | | | X | D2580-047 | SKIDTUBE ASSEMBLY |
| 4 | 1 | 1 | 1 | D2500-1-190 | EXTRUSION |
| 5 | | | 16 | D2570 | BUSHING |
| 6 | 1 | 1 | 1 | D2576-3 | STEP |
| 7 | 20 | 24 | 25 | D2579 | SPACER |
| 8 | 16 | 16 | 8 | D2594-1 | PLUG |
| 9 | 16 | 16 | 8 | D2594-3 | O-RING |
| 10 | 1 | 1 | 1 | D2596 | 205 WEB |
| 11 | 1 | 1 | 1 | D2855 | AFT CAP |
| 12 | 1 | 1 | | D3564-5 | WEARSHOE |
| 13 | 1 | 1 | | D3564-9 | WEARSHOE |
| 14 | 1 | 1 | | D3564-11 | WEARSHOE |
| 15 | 1 | 1 | | D3564-13 | WEARSHOE |
| 16 | 2 | 2 | | D3566-1 | GASKET |
| 17 | 1 | 1 | | D3566-5 | GASKET |
| 18 | 1 | 1 | | D3566-13 | GASKET |
| 19 | | | 1 | D4406-041 | WEARPLATE ASSEMBLY |
| 20 | | | 1 | D4406-043 | WEARPLATE ASSEMBLY |
| 21 | 50 | 50 | | ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130 | INSERT |
| 22 | 50 | 50 | | AN3C4A | BOLT |
| 23 | 2 | 2 | 2 | AN3-5A | BOLT |
| 24 | | | 8 | AN4-45A | BOLT |
| 25 | 50 | 50 | | NAS1149C0332R | WASHER (AN960C10L) |
| 26 | 2 | 2 | 2 | NAS1149D0332J | WASHER (AN960JD10L) |
| 27 | | | 8 | MS21042-4 | NUT (OR MS21042L4) |

GENERAL NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY (-041/-047) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
POWDER COAT ASSEMBLY (-045) GREEN SANDEX (REF 4.3.5.8) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D2580-041 = 34.5 lbs
D2580-045 = 34.5 lbs
D2580-047 = 37.7 lbs
- 8) WELDING PER DART QSI 004.
- 9) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 10) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 11) USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241/291.
- 12) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047)
- 13) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

DEO ATTACHED


RELEASED
2011-08-29

| | | | |
|------------|---|---|--------------|
| E | ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-8); INCLUDED DEO D2580-D-1; REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS TD2577-205 (ZN C4-1) | RF | 11.06.21 |
| D | CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183 | PH | 07.04.05 |
| C | REDRAWN, INCLUDED DEO 9094/9097 | CP | 98.08.26 |
| B | AS MANUFACTURED | DS | 96.12.02 |
| A | NEW ISSUE | DS | 96.09.16 |
| REV. | DESCRIPTION | BY | DATE |
| DESIGN | # | DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA | |
| DRAWN | RF | | |
| CHECKED | 10 | DRAWING NO. | REV. E |
| MFG. APPR. | 10 | D2580 | SHEET 1 OF 8 |
| APPROVED | 10 | TITLE | SCALE |
| DE APPR. | 10 | 205 SKIDTUBE ASSEMBLY | NTS |
| DATE | 11.06.21 | COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD | |

COPY
SENT
9.2777 MJS
12-11-07




DEO ATTACHED
RELEASED
2011-08-29
WHD



- | | | | |
|------------|---------------|--|--------------|
| DESIGN | 4 | DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA | |
| DRAWN | RF | | |
| CHECKED | 10 | DRAWING NO. | REV. E |
| MFG. APPR. | 10 | D2580 | SHEET 2 OF 8 |
| APPROVED | 10 | TITLE | SCALE |
| DE APPR. | 10 | 205 SKIDTOE ASSEMBLY | NTS |
| DATE | 11.06.21 | COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT FOR USE, FOR ANY PURPOSE ON COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION FROM DART AEROSPACE LTD. | |

92777

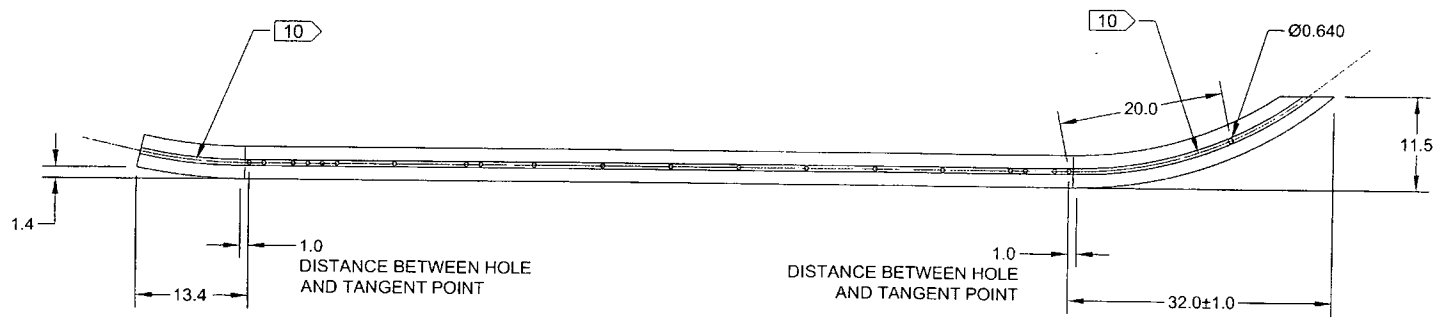


D2580-1 BENT TUBE
(MAKE FROM D2580-101 TUBE)

DEO ATTACHED


RELEASED
2011-08-28

| | | | |
|----------|----------|--|--------------|
| DESIGN | # | DART AEROSPACE LTD | |
| DRAWN | RF | HAWKESBURY, ONTARIO, CANADA | |
| CHECKED | 10 | DRAWING NO. | REV. E |
| MFG APPR | 10 | D2580 | SHEET 3 OF 8 |
| APPROVED | 10 | TITLE | SCALE |
| DE APPR. | 10 | 205 SKIDTUBE ASSEMBLY | NTS |
| DATE | 11.06.21 | <small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small> | |


92777

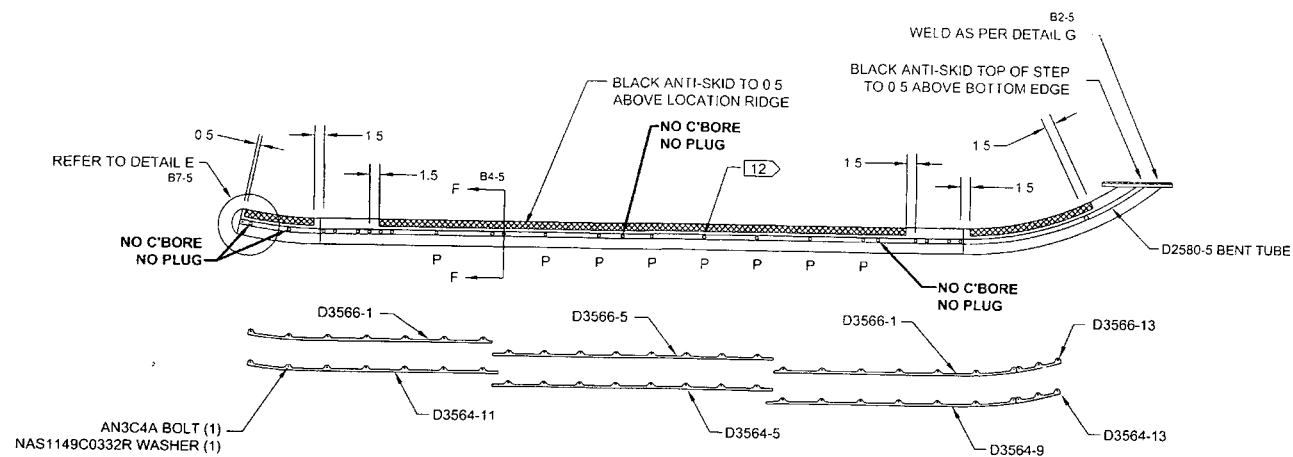


D2580-045 ASSEMBLY DETAIL

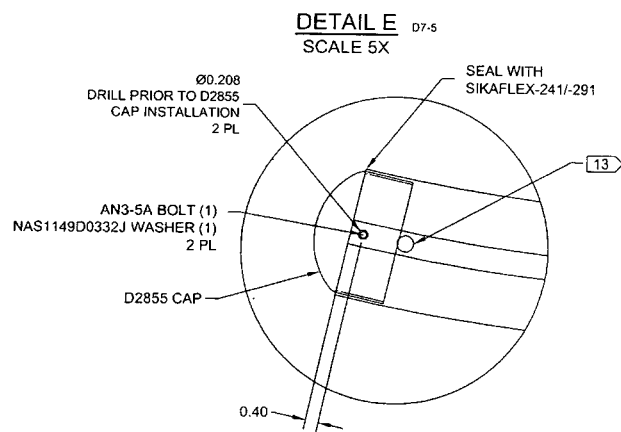

DETAIL E D7-5
SCALE 5X

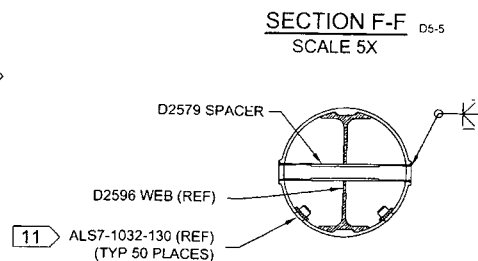


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (24 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

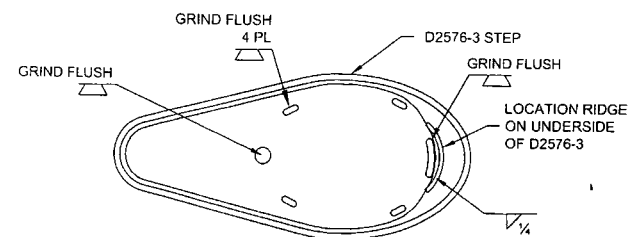

DETAIL G D3-5
SCALE 5X

| | | | |
|------------|----------|---|--------------|
| DESIGN | # | DART AEROSPACE LTD | |
| DRAWN | RF | HAWKESBURY, ONTARIO, CANADA | |
| CHECKED | 10 | DRAWING NO | REV. E |
| MFG. APPR. | 10 | D2580 | SHEET 4 OF 8 |
| APPROVED | 10 | TITLE | SCALE |
| DE APPR | 10 | 205 SKIDTUBE ASSEMBLY | NTS |
| DATE | 11.06.21 | <small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small> | |


92777

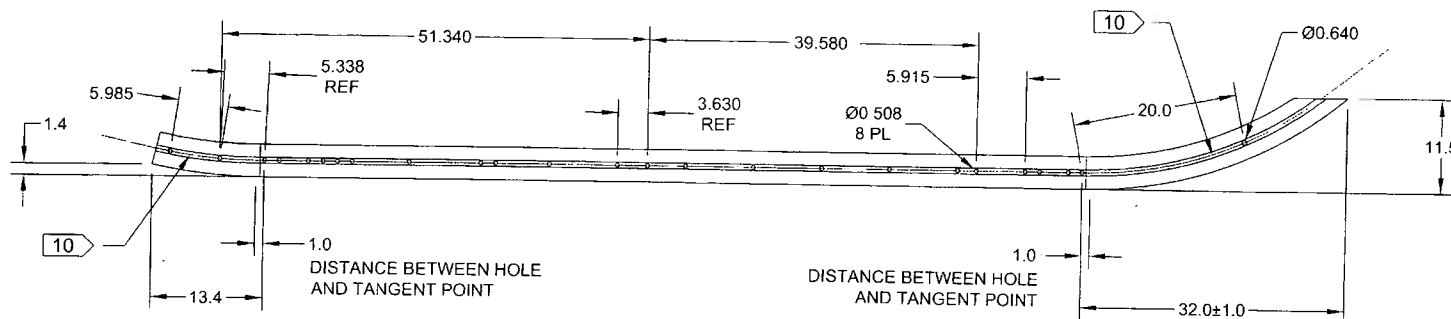

D2580-5 BENT TUBE
(MAKE FROM D2580-101 TUBE)

DEO ATTACHED
RELEASED
2011-08-29
ND

| | | | |
|------------|----------|---|--------------|
| DESIGN | # | DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA | |
| DRAWN | RF | | |
| CHECKED | 140 | DRAWING NO. | REV. E |
| MFG. APPR. | 140 | D2580 | SHEET 5 OF 8 |
| APPROVED | 140 | TITLE | SCALE |
| DE APPR. | # | 205 SKIDTUBE ASSEMBLY | NTS |
| DATE | 11.06.21 | COPYRIGHT © 1986 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE LOANED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD. | |

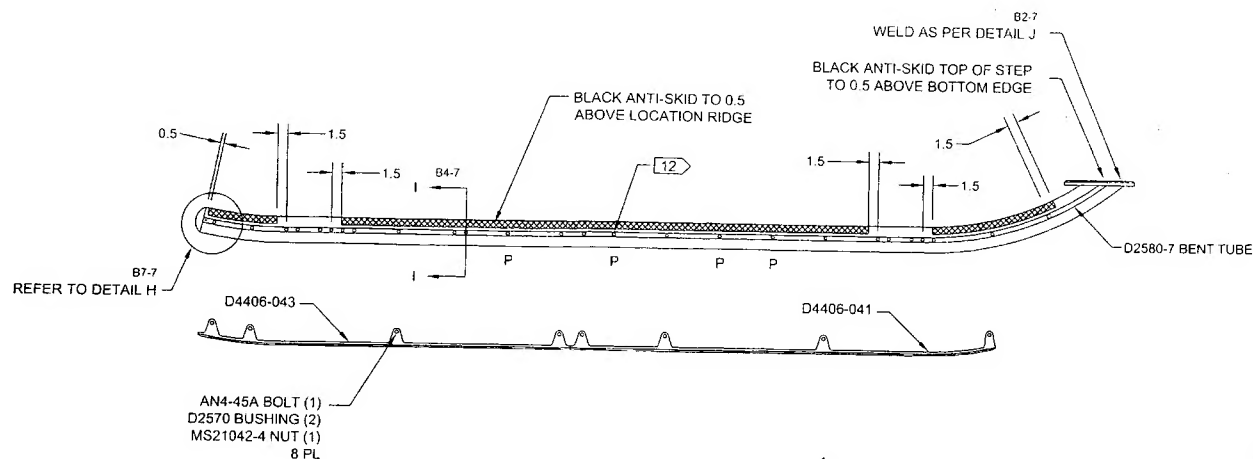


D2580-047 ASSEMBLY DETAIL 

DEO ATTACHED


RELEASED
2011-08-28

2011-08-29

DETAIL J D3-7
SCALE 5X

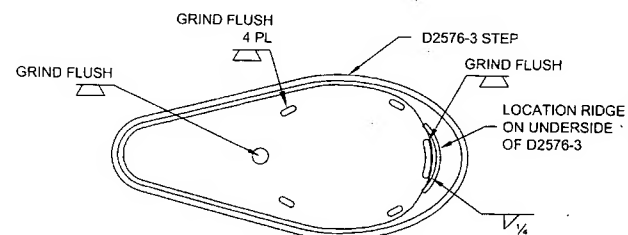


SECTION I-I 05-7
SCALE 5X

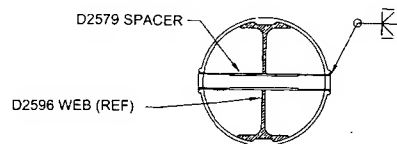

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø.508 HOLES ONLY:


1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (25 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

DETAIL H C6-7
SCALE 5X

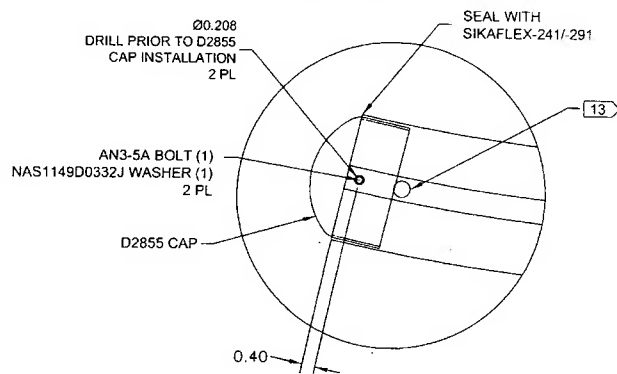

| | | | |
|------------|----|---|------------|
| DESIGN | # | DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO D2580 TITLE 205 SKIDTUBE ASSEMBLY COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE PROPERTY OF THE EXPRESS COMPANY. IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE LTD. | REV |
| DRAWN | RF | | SHEET 6 OF |
| CHECKED | 10 | | SCALE |
| MFG. APPR. | 10 | | NT |
| APPROVED | 10 | | |
| DE APPR. | 10 | | |
| DATE | | 11.06.21 | |

92777

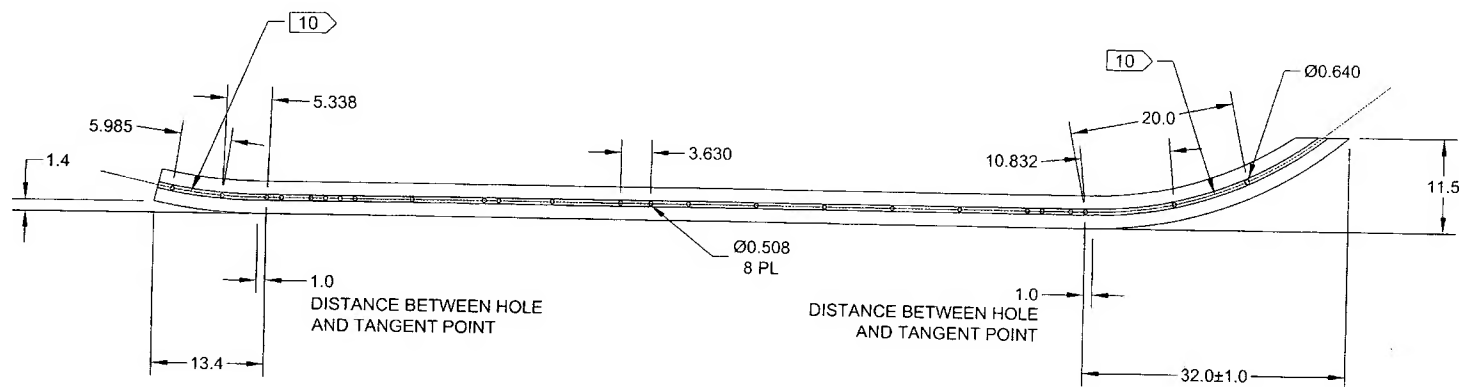



D2580-7 BENT TUBE
(MAKE FROM D2580-101 TUBE)



DEO ATTACHED
RELEASED
2011-08-29

| | | | |
|------------|----------|---|--------------|
| DESIGN | # | DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA | |
| DRAWN | RF | | |
| CHECKED | 140 | DRAWING NO. | REV. E |
| MFG. APPR. | 140 | D2580 | SHEET 7 OF 8 |
| APPROVED | 140 | TITLE | SCALE |
| DE APPR. | 140 | 205 SKIDTUBE ASSEMBLY | NTS |
| DATE | 11.06.21 | <small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small> | |

92777

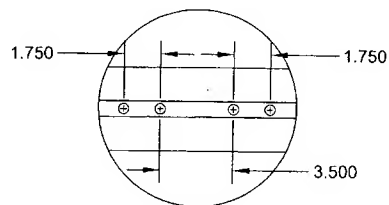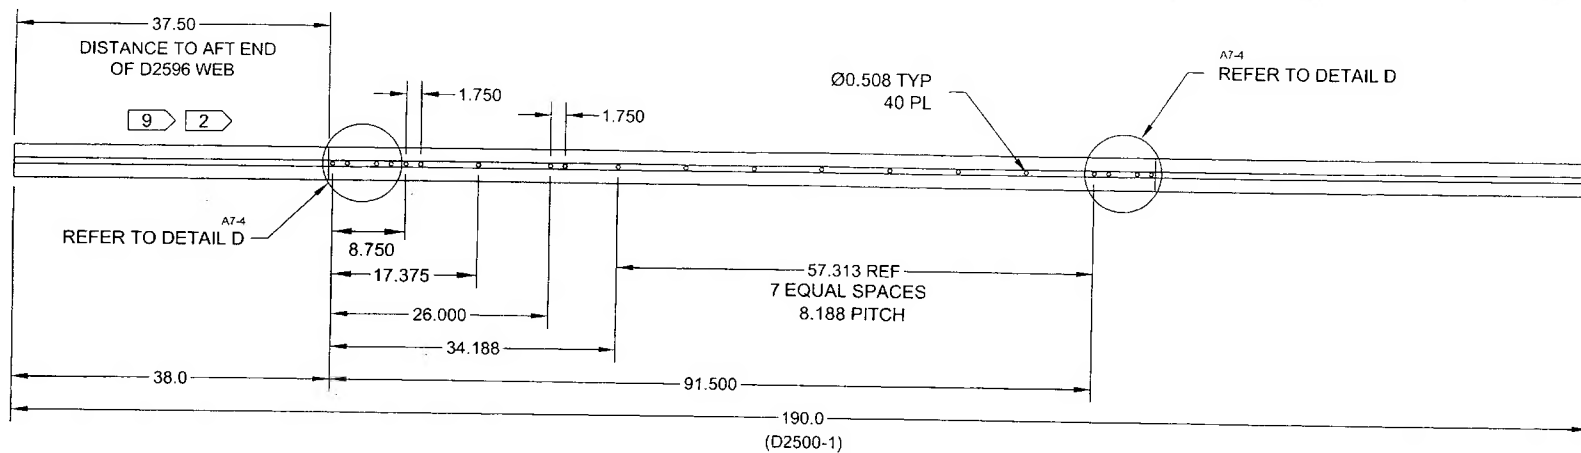

DETAIL D D3-4
SCALE 5X C7-4

D2580-101 TUBE

DEO ATTACHED

RELEASED
2011-08-29

| | | | |
|------------|----------|--|--------------|
| DESIGN | # | DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA | |
| DRAWN | RF | | |
| CHECKED | 10 | DRAWING NO. | REV. E |
| MFG. APPR. | 10 | D2580 | SHEET 8 OF 8 |
| APPROVED | 10 | TITLE | SCALE |
| DE APPR. | # | 205 SKIDTUBE ASSEMBLY | NTS |
| DATE | 11.06.21 | <small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small> | |

| | | | | | | | |
|----------------------|--------------------------------|-------------------------|---|--|-------------------------|---------------------------|--------------|
| DRAWING NO. D2580 | TITLE 205 SKIDTUBE ASSEMBLY | REV. E | DART AEROSPACE LTD ENGINEERING ORDER | | D.E.O. NO. D2580-E-1 | SHEET NO. SHEET 1 OF 1 | SCALE NTS |
| DRAWN <i>DP</i> | CHECKED <i>ASS</i> | MFG. APPR. <i>EC</i> | APPROVED <i>#</i> | | DE APPR. <i>#</i> | | |
| DATE 11.12.13 | DATE 11.12.13 | DATE 11.12.13 | DATE 11.12.13 | | DATE 11.12.13 | | |

PURPOSE:

CHANGE ALL C'BORED WELDED CROSSBOLT SPACERS TO SWAGED SPACERS

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

WAS

| QTY | QTY | QTY | PART NUMBER | DESCRIPTION |
|------|------|------|-------------|-------------------|
| -041 | -045 | -047 | | |
| 20 | 24 | 25 | D2579 | CROSS BOLT SPACER |

IS


| | | | | |
|----|----|----|---------|-------------------|
| | 4 | | * D2579 | CROSS BOLT SPACER |
| 20 | 20 | 25 | D4202-1 | SPACER |

SECTION B-B, SECTION F-F, & SECTION I-I ARE AMENDED AS FOLLOWS
FOR ALL HOLES THAT WERE ORIGINALLY C'BORED:

*** FOR -045 SKIDTUBE ONLY:**

WELD 4X D2579 SPACERS PER DWG
IN LOCATIONS MARKED "NO C'BORE".
REF SHEET 4 OF DWG.

RELEASED
2011-12-14

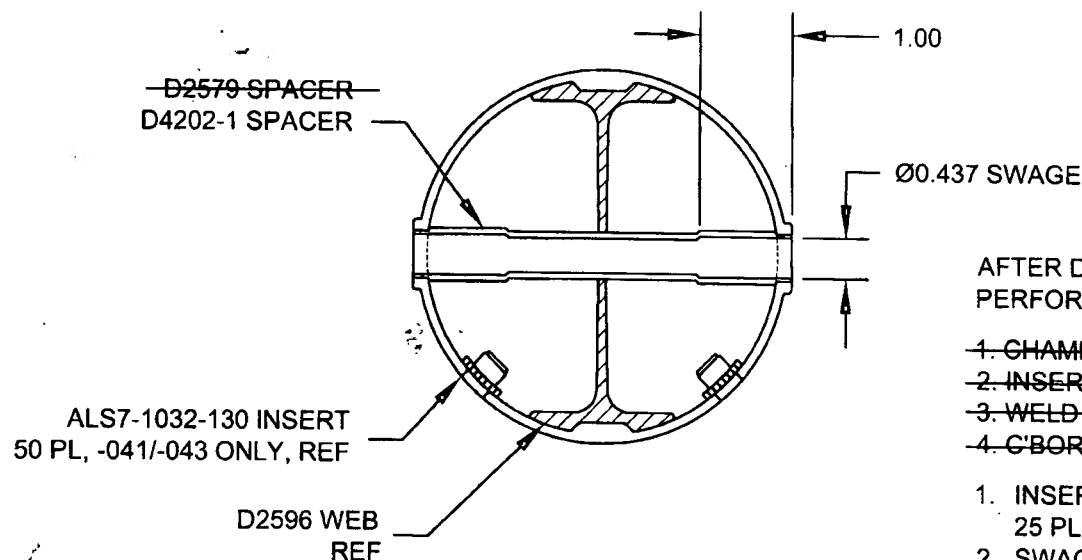

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:

1. CHAMFER HOLE 0.060 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

1. INSERT D4202-1 SPACER, 20 PL (-041) OR 20 PL (-045) OR 25 PL (-047)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM / GRIND FLUSH PER QSI 002

SECTION B-B, F-F, I-I
NOT TO SCALE